

IMPORTANT INSTALLATION NOTE!!!!!

IMPROPER INSTALLATION OF HUB COULD CAUSE PREMATURE WEAR AND OR FAILURE.

IF YOU HAVE QUESTIONS CONCERNING LOCATION OF METAL HUB ON PUMP SHAFT PLEASE CONTACT DISTRIBUTOR OR FACTORY FOR FURTHER INFORMATION

BOTH HUB SET SCREWS MUST BE PROPERLY TORQUED TO 25 FT.LBS. USING TORQUE WRENCH. PLEASE CONTACT DISTRIBUTOR OR FACTORY FOR ANY FURTHER QUESTIONS.


FITS KUBOTA 2403-M, FITS FLYWHEEL #1G850-25013 AND HOUSING #1G850-04613 OR SIMILAR PARTS.

> **B TORQUE RANGE** (30-75 HP)

NOTE: THIS STEP IS IMPORTANT TO ENSURE FULL SPLINE ENGAGEMENT.

- 1) PRESET HUB ON SHAFT AS SHOWN.
- 2) IF YOUR PUMP SHAFT VARIES FROM THE DRAWN SHAFT LENGTH, CONTACT FACTORY FOR RECOMMENDATIONS.
- TORQUE BOTH SET SCREWS TO 25 FT.LBS. USING **TORQUE WRENCH.**
- 4) SHAFT SHOULD HAVE FULL SPLINE ENGAGEMENT INTO HUB, IF NOT CONTACT FACTORY FOR RECOMMENDATIONS (231) 879-3372.

THIS DRAWING IS THE PROPERTY OF HAYES MFG. INC. AND IS LOANED SUBJECT TO THE CONDITION THAT IT SHALL NOT BE REPRODUCED. COPIED, LOANED OR OTHERWISE DISPOSED OF, DIRECTLY OR MODIFICATLY. IT SHALL BE USED AS A MEANS OF REFERENCE TO WORK FURNISHED BY THIS COMPANY ONLY AND IS NOT TO BE SUBMITTED TO OUTSIDE PARTIES FOR EXAMINATION WITHOUT OUR CONSENT.

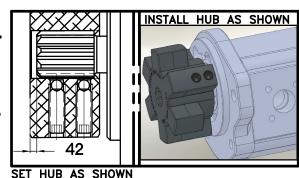

	3	961455-	02 SAE 5 DISHED P			PLATE		1
	2	HB3-91	HEX-FLX H		-FLX HUB			1
	1	B-S03	HEX-FLX PLATE					1
SYMBOLS	DET.	PART NU	JMBER		DESCRIPTION			QTY.
FLATNESS STRAIGHTNESS ANGULARITY PERPENDICULARITY PARALLELISM CONCENTRICITY THE POSITION ON ROUNDNESS CIRCULAR RUN OUT CYLINDRICITY FINISH FINISH	Y TOLERY OTHERN 1257 AN FRAC UT	NOT SCALE DRAWING ANCES UNLESS WISE SPECIFIED MAXIMUM GLE ±1/2' TION ±1/32 DECIMAL 00 ±.01 00 ±.005 00 ±.005						
CLASS KUBOTA	MAKE: X BUY:		DRAWN BY SIETING	c	ate 13-20-2013	DRAWING N		91-B2
DESCRIPTION 051-0-HB3-91-	CHECKED B	Y S	CALE	SHEET	OF	REV.		