

CHANGE DESCRIPTION REV DATE MOD.BY CK1 CK2

S.A.E. B 2-BOLT MOUNT 4.00" PILOT (4) 1/2-13 TAPPED HOLES EQ. SPACED ON A 5.75 B.C.

NOTES:

1. HOUSING FOR KUBOTA ENGINES D-905, D1005-B, D1105-B, V1205-B, V1305-P, AND V1505-B.

IMPORTANT INSTALLATION NOTE!!!!!

IMPROPER INSTALLATION OF HUB COULD CAUSE PREMATURE WEAR AND OR FAILURE.

IF YOU HAVE QUESTIONS CONCERNING LOCATION OF METAL HUB ON PUMP SHAFT PLEASE CONTACT DISTRIBUTOR OR FACTORY FOR FURTHER INFORMATION.

BOTH HUB SET SCREWS MUST BE PROPERLY TORQUED TO 25 FT.LBS. USING TORQUE WRENCH . PLEASE CONTACT DISTRIBUTOR OR FACTORY FOR ANY FURTHER QUESTIONS.


6 BLACK PLUG C-32-U-200 OR C36-2-U-2000 5 952182 BOLT KIT 4 PURCHASE 5/16 DIA x 1/2 DOWEL PIN 3 952055-03 HOUSING 2 HB2-89 HEX~FLX HUB 1 B-S05 HEX~FLX DRIVE PLATE

			D 300		TIER-TEX D	INIVE I DAIL			
	SYMBOLS FLATNESS STRAIGHTNESS ANGULARITY PERRENDICULARITY PARALLEUSM CONCENTRICITY TOTAL RUN OUT CIRCULAR RUN OUT TOTAL RUN OUT CYLINDRICITY FINISH	DET. PART NU		JMBER	DES	DESCRIPTION		QT	
		DO NOT SCALE DRAWING TOLERANCES UNLESS OTHERWISE SPECIFIED 1287 MAXIMUM ANGLE ±1/2' FRACTION ±1/32 DECIMAL .00 ±.01 .000 ±.005 .0000 ±.0005		MANUFACTURING INC. ® TITLE KUBOTA -05 HEX~FLX ASS'Y					
				MATERIAL					
	- UNLESS OTHERWISE SPECIFIED -			DRAWN BY	DATE	DRAWING N	ю.		
	REMOVE FIRST THREAD ON ALL TAPPED HOLES			SIETING	10-30-0	07 006 0	006-0-HB2-8		
	BREAK ALL SHARP CORNERS .010 TO .020 STAMP OR MARK DRAWING NO.		S .010 TO .020	CHECKED B	Y SCALE				
			RJH		SHEET	OF	REV.		

NOTE: THIS STEP IS IMPORTANT TO ENSURE FULL SPLINE ENGAGEMENT.

- 1) PRESET HUB ON SHAFT AS SHOWN.
- IF YOUR PUMP SHAFT VARIES FROM THE DRAWN SHAFT LENGTH, CONTACT FACTORY FOR RECOMMENDATIONS.
- TORQUE BOTH SET SCREWS TO 25 FT.LBS. USING TORQUE WRENCH.
- SHAFT SHOULD HAVE FULL SPLINE ENGAGEMENT INTO HUB. IF NOT CONTACT FACTORY FOR RECOMMENDATIONS (231) 879-3372.

THIS DRAWING IS THE PROPERTY OF HAYES MFG, INC. AND IS LOANED SUBJECT TO THE COMDITION THAT IT SHALL NOT BE REPRODUCED. OPPIED, LOANED OR OTHERWISE DISPOSED OF, DIRECTLY OR INDIRECTLY, IT SHALL BE USED AS A MEANS OF REFERENCE TO WORK FURNISHED BY THIS COMPANY ONLY AND IS NOT TO BE SUBMITTED TO OUTSIDE PARTIES FOR EXAMINATION WITHOUT OUR CONSENT.

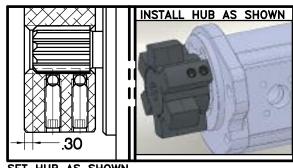

SET HUB AS SHOWN